

Transparent Straight Adapter



Model	d	Outer Thread	A	B (mm)	C (mm)	H (mm)	N.W. (g)	Set
DV-5	Ø2.5	PT1/8xPT1/8	Ø15	30	57	10	25	- -
DV-10	Ø5.0	PT1/4xPT1/4	Ø22	50	90	17	85	- -

Tube Insert

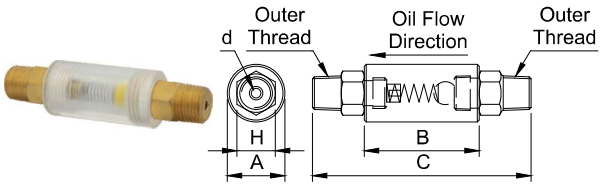


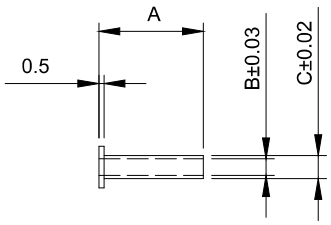

Model	Bore	A (mm)	B	C	N.W. (g)	Set
PO-403	Ø4	10	Ø1.50	Ø2.05	0.16	- -
PO-4			Ø1.60	Ø2.10	0.16	- -
PO-405			Ø1.60	Ø2.20	0.16	- -
PO-401			Ø1.70	Ø2.50	0.25	- -
PO-601	Ø6	12	Ø3.34	Ø3.95	0.43	- -

Connector




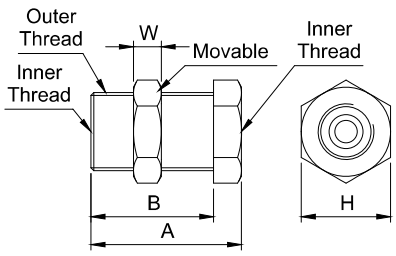

Model	Bore	Inner Thread	Outer Thread	A (mm)	B (mm)	H (mm)	W (mm)	N.W. (g)	Set
PM-104	Ø4	M8xP1.0	M12xP1.0	27	22	14	5	21	*
PM-106	Ø6	M10xP1.0	M14xP1.0	27	22	16	5	26	*
PM-108	Ø8	M14xP1.5	M18xP1.5	33	26	21	7	49	*
PM-110	Ø10	M16xP1.5	M20xP1.5	36	28	23	8	62	*

2-Way Junction A/B



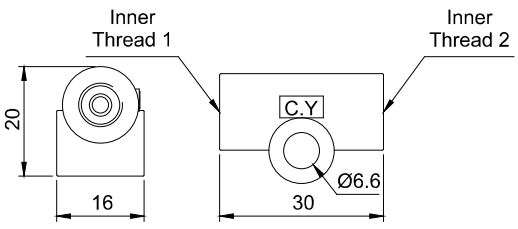

2-Way Junction A					
Model	Bore	Inner Thread 1	Inner Thread 2	N.W. (g)	Set
JD-4	Ø4	M8xP1.0		27	*
JD-6	Ø6	M10xP1.0		23	*
2-Way Junction B					
Model	Bore	Inner Thread 1	Inner Thread 2	N.W. (g)	Set
JD-601	Ø6	M10xP1.0	PT1/8	22	*
JD-406	Ø6xØ4	M10xP1.0	M8xP1.0	25	*

※ The model with an " * " mark can be assembled with compression bushing and compression sleeve as a set. If you need the model as a set, please specify when you place an order.