

Connect A/B

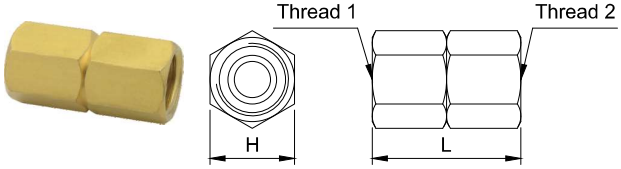


Connector A							
Model	Bore	Inner Thread 1	Inner Thread 2	H (mm)	L (mm)	N.W. (g)	Set
PM-4	Ø4	M8xP1.0		10	26	17	*
PM-6	Ø6	M10xP1.0		12	26	12	*
PM-8	Ø8	M14xP1.5		17	33	40	*
PM-10	Ø10	M16xP1.5		19	37	51	*
PM-12	Ø12	M18xP1.5		21	37	65	*
Connector B							
Model	Bore	Inner Thread 1	Inner Thread 2	H (mm)	L (mm)	N.W. (g)	Set
PN-4	Ø4	M8xP1.0	PT1/8	12	23	16	*
PN-6	Ø6	M10xP1.0	PT1/8	12	23	12	*
PN-10	Ø10	M16xP1.5	PT1/4	19	32	58	*

Connector

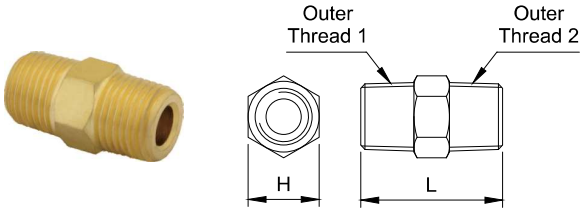


Model	Outer Thread 1	Outer Thread 2	H (mm)	L (mm)	N.W. (g)	Set
CN-101	PT1/8	PT1/8	10	21	8.0	- -
RN-102		PT1/4	14	23	16.0	- -
CN-202	PT1/4	PT1/4	14	25	10.0	- -
RN-203		PT3/8	17	27	18.0	- -
PROCPS	M8xP1.0	PT1/8	10	22	8.4	- -
PROCPV-1		M8xP1.0	10	22	6.6	- -
PTD10010	M10xP1.0	PT1/8	10	20	8.5	- -
PTD10100		M10xP1.0	10	20	7.5	- -

Swivel Straight Adapter

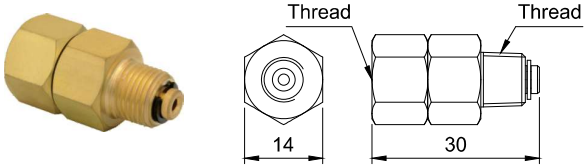


Model	Inner Thread	Outer Thread	N.W. (g)	Set
SS-101	PT1/8	PT1/8	26	- -
SS-401	M8xP1.0	PT1/8	28	*

Plane Swivel Elbow Adapter A

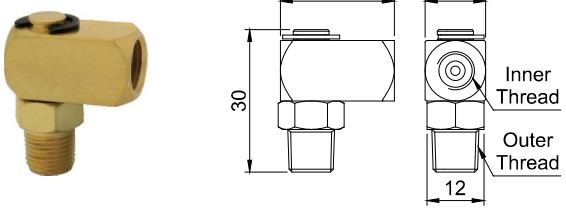

Model	Inner Thread	Outer Thread	N.W. (g)	Set
ES-401(A)	M8xP1.0	PT1/8	38	*
ES-601(A)	M10xP1.0	PT1/8	38	*

Plane Swivel Elbow Adapter B

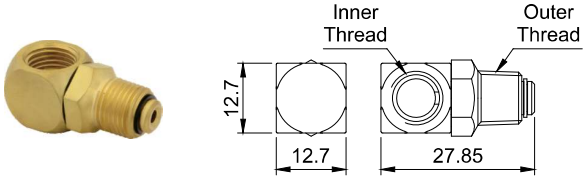

Model	Inner Thread	Outer Thread	N.W. (g)	Set
ES-101(B)	PT1/8	PT1/8	36	- -

※ The model with an " * " mark can be assembled with compression bushing and compression sleeve as a set. If you need the model as a set, please specify when you place an order.